English version









Checked item	Seaworthy condition
Exterior	No strange labels
Interior	Dry and clean No hole, no bad smell Oil stain on floor; rust on roof and panel if any: dry and non- transferrable


Deformation type	Acceptable limit
Dent on panel	Acceptable if internal width doesn't change exceeding 50 mm compared to standard size
Gouge on floor	Acceptable if gouge is not protruded, within 15 mm depth or within 6 mm depth and 150 mm width
Strange stain on floor or panel	Acceptable once dry and non-transferrable. Test by hand or tissue







#### **Illustration 1: Dent on panel**

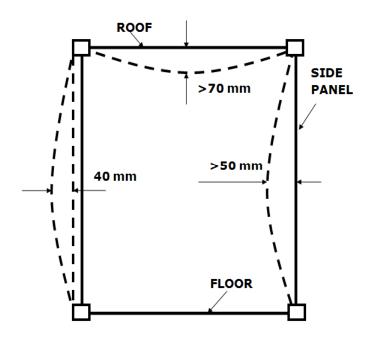

Acceptable if internal width doesn't change exceeding 50 mm compared to standard size.

Dent less than the outer face of corner casting 40 mm







#### **Illustration 2: Gouge on floor**



**Acceptable** if gouge is within 15 mm of depth or 6 – 15 mm of depth and 150 mm of width











**Illustration 3: Oil stain on floor** 



Acceptable once dry and nontransferrable. Test by hand or tissue.









Illustration 4: Strange black stain on panels or floor



Acceptable once dry and non-transferrable. Test by hand or tissue.









**Illustration 5: Rust stain on side panel** 




Acceptable once dry and nontransferrable. Test by hand or tissue.







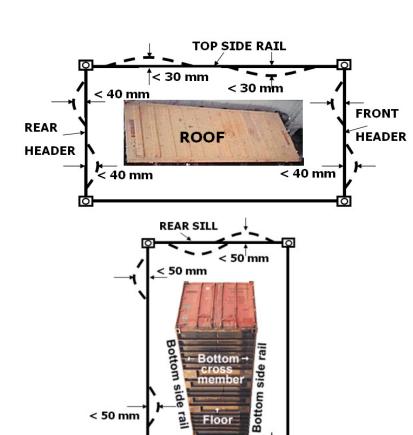

# **Illustration 6: Deformation on side rail**

#### **Acceptable** if

- -Top side rail deforms within 30 mm
- -Front, rear header deforms within 40 mm
- Bottom side rail deforms within 50 mm
- -Front, rear sill deforms within 50 mm







## Thank you!

Should you have any question, please do not hesitate to contact Maersk Line Equipment team:

- Email Address: Phyrun.kim@maersk.com

- Tel: +855 23 727817

- Mobile: +855 12 550806

